UNCLASSIFIED
AD NUMBER
AD492162
LIMITATION CHANGES
TO: Approved for public release; distribution is unlimited.
FROM: Distribution authorized to U.S. Gov't. agencies and their contractors; Administrative/Operational Use; 15 APR 1946. Other requests shall be referred to Naval Research Lab., Washington, DC.
AUTHORITY
NRL ltr 14 May 1971

AD 492162

## DEFENSE DOCUMENTATION CENTER

FOR

SCIENTIFIC AND TECHNICAL INFORMATION

CAMERON STATION ALEXANDRIA. VIRGINIA




UNCLASSIFIED

NOTICE: Wher government or other drawings, specifications or other data are used for any purpose other than in connection with a definitely related government procurement operation, the U. S. Government thereby incurs no responsibility, nor any obligation whatsoever; and the fact that the Government may have formulated, furnished, or in any way supplied the said drawings, specifications, or other data is not to be regarded by implication or otherwise as in any manner licensing the holder or any other person or corporation, or conveying any rights or permission to manufacture, use or sell any patented invention that may in any way be related thereto.

492162

NAVAL RESEARCH LABORATORY
REPORT

492162



NAVAL RESEARCH LABORATORY

WASHINGTON 20 D C

PC

COPY NO. 39

### NAVY DEPARTMENT - OFFICE OF RESEARCH AND INVENTIONS

NAVAL RESEARCH LABORATORY Washington, D. C.

AIRBORNE RADIO DIVISION - ENGINEERING ANALYSIS SECTION

AIRBORNE RAD	10 DIVISION - ENGINEERING ARREISIS SECTION	
	11 15 Apr 46,	
	13/7p. 9 Interim rept.	
•	(C) TYPE TEST OF	_
ACSESSIGN for	AN/APS-20A.  C. B. Barnes	
CESTAL WHITE SECTION (	I. W. Fuller.	3
UKA "NOUNCED CELL	- Report R-2809 - (14) NRL-R-2809	
BIST. AVAIL and or S. COTAL		
7	Approved by:	
G. C. Schle	ter - Head, Engineering Analysis Section	
Raymond A. Gordon Acting Supt. Airborne	Radio Division Commodore H. A. Schade, USA Director, Naval Research Labora	
		1
	Preliminary Pages	0150
	Plates Distribution List.	6
	DOWNGRAPUD AT 2 YEAR INTERVALS: DECLARATION OF LINES	
Problem No. S2111T-C	MAY 8 1956	4
L	56AA 19770 -	T.
AT 251 95	- UNCLASSIFIED ey	

#### ABSTRACT

The AN/APS-20A is a high-powered Airborne Early Warning radar system. It is capable of detecting and mapping targets located within the search horizon determined by the airpiane altitude. The information thus obtained is reproduced on two PPI tubes within the plane as well as being simultaneously relayed by radio relay equipment to some remote point and being reproduced there. The results of the noise and interference tests on this equipment are covered in this report. They show that both the radiated and conducted noise levels are much too high for use in Naval aircraft. Recommendations are made which give means of reducing the noise to a reasonable level.

UNCLASSIFIED.

56AA 19770

#### TABLE OF CONTENTS

																													1.9	ge
RÆSU.	LTS	OF	TE	STS	<b>S</b> .													-			•							•		1
	Ra	dia	ted	No	i	<b>se</b>													•	•		•	•	•	•	•	•	•	•	1
COMC	LUS	ION																				•			•	•	•	•	•	S
RECC	114	NDA	TIO	NS		•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	2
REF	Rail.	ധ്യ		•	•		•	•	•	•			•	•	•	•	•		•	•	•	•	•	•	•	•	•	•	•	4
Tabl																				r										
Tabl																														
Tabl																														
Tabl	e 5	_	D.C	. 1	Li	ne	to	o (	ire	ou	nd																			
Tabl	e 6	-	Lin	e (	Coi	ndı	ac.	te	1	No.	is	е	-	h-	C :	Li	ne	(ø.	A)	t	0 (	Gr	ow	nd						
Tabl																														
Plat	<b>e</b> 1		Mod	ul.	ate	or	F	il	te	r	Sc	he	ma	ti	С															
DIST	RIB	UTI	ON							•							•	•	•	•	•	•	•	•	٠	•	•	•	•	-d-

#### RESULTS OF TESTS

- 1. Due to particular interest shown by the Bureau of Ships and the Bureau of Aeronautics, the radio noise and interference tests were made first.
- 2. As a criteria for what would be considered excessive radiated radio interference, a set of receivers; as called for in reference (c) was used. A noise probe was used to determine the sources of noise.

#### Radiated Noise

- 3. After satisfactory operation of the AN/APS-20A had been accomplished, it was found that the r.f. head blower (HD-7) and the maggie blower (HD-6) radiated so much that they would have to be corrected before any other noise measurements could be made.
- the frame of the HD-7 blower did not have good electrical continuity between its parts and to the r. f. head mounting base. This lack of continuity was caused by paint and/or lacquer on the parts. It was also found that the small double pi filter used on the blower offered insufficient attenuation to the lower and medium frequencies. The interfering paint and/or lacquer was removed and a new filter was designed for the positive load of the motor. The filter was the same as was used in lead "N" of the modulator filter shown in plate 1. After these remedial steps had been taken, the radiated noise from the motor had been reduced to satisfactory level.
- 5. It was necessary to carry out the same remedial steps on the HD-6 blower and the antenna drive motor. It was also necessary to completely enclose these motors in a copper screen. Results are shown in tables I, II and III.
- 6. The pump motor was checked and it was found that after covering it with small screen wire, it came within the tolerable limits of radiated noise. The filter used on the pump was the only one in the system which sufficiently attenuated the noise on the d.c. lines.
- 7. Upon completion of the above tests, the modulator was checked for radiated poise. Very high radiated noise was found all around the modulator. After satisfactorily grounding the modulator, the radiated noise was still excessive around the modulator waistband and two plugs, J1001 and J1007.
- 8. It was found that the waistband could not be tightened sufficiently to prevent noise leakage. There was considerable noise leakage around the waistband supporting ring since it was spot-welded only in a few places. This was made into a continuous weld all around the waistband support. A new waistband was supplied by General Electric. It showed no improvement over the old weistband and was more difficult to install.

- 9. The interconnecting cable from J1007 to the relay box inside the modulator was wrapped with copper foil and grounded in several places. This reduced the radiated noise at the plugs J1001 and J1007 by a considerable amount. (Refer to Table IV).
- Upon completion of the radiated noise measurements, conducted noise checks were made at the distribution box with a Ferris Model 32-B noisemeter. The results of these measurements can be found in Table VI. The conducted noise on the A-C power leads, with the modulator operating, was over 100,000 microvolts. A filter was designed and installed between the modulator cable and the modulator. (Refer Plate 1 and Table VII). The results of this filter can be seen in Table VI. The modulator trigger was rerouted so that it went directly from the added filter unit to the synchronizer and did not go to the modulator control box.
- Upon suggestion of the Bureau of Aeronautics, certain charges in cabling were made as were recommended in reference (d) for the AN/APS-20. These changes were originally made on the AN/APS-20 at NAMU (Johnsville, Ph.) and were made here on the AN/APS-20A to determine if the same changes were necessary. Only one of the changes was found to be necessary. This was the re-routing of the modulator trigger cable to go directly to the synchronizer.

#### CONCLUSIONS

12. It is concluded that:

(a) The radiated and conducted radio noise from all d. c. blowers, the antenna drive motor, and the modulator is much too high for satisfactory use of the AN/APS-20A in Naval aircraft.

#### RECOMMENDATIONS

- 13. It is recommended that the following things be done in order to reduce radio interference from the AN/APS-204.
  - (a) All metal to metal contacts be thoroughly cleaned of paint and lacquer so that good electrical contact is maintained between parts of the system. This should include the various parts of the blowers and motors.
  - (b) The filters used on the d.c. blowers and on the antenna drive motor be redesigned to provide much more attenuation to low and medium frequencies (100 Kc to 18 mc region).
  - (c) The modulator ring support for the waistband be fastened to the modulator cover with a solid wold.

- (d) The cable from J1007 to the relay box (within modulator) be provided with a tubular shield completely enclosing and shielding all of this cable.
- (e) A waistband be designed which will clamp together the parts of the modulator case with more uniform holding prossure as well as much better electrical contact.
- (f) A filter be designed and inserted in the d.c. and a.c. leads of cable, w3002, between modulator and control box. The filter shown in plate 1 was found to be satisfactory.
- (g) The modifications recommended in ref. (d) for the AN/APS-20 are not necessary on the AN/APS-20A except that the modulator trigger cable be re-routed to go directly from modulator to synchronizer.
- (h) All units of the AN/APS-20A system should be very thoroughly bonded to the airplano.

C. D. Jarnes Lecio la jacin

1. .. Police Radio Engineer

f. D. Schaller

Senior Radio Engineer

#### REFERENCE

- (a) BuShips ltr. Sec. 944D 944ZB,23 Oct. 1945.
- (b) Buner Formative outline of Performance Requirements and Design Objectives.
- (c) BuShips Contract Spec. CS-434, 15 November 1946.
- (d) Buser ltr. ser-E-2146-HBD F42-5/36(sEv), 25 January 1946.
- (e) BuShips Spec. RE13.585B, 15 December 1943.

TABLE 1

#### RADI. TED NOISE - ANTENNA DRIVE MOTOR

Freq.	Equivalent Input $\mu V$ .	Freq.	Equivalent Input #V.
0.104 0.119 0.144 0.172 0.200 0.300 0.400 0.500 0.582 0.692 0.791 0.840 1.2 1.47	56 47 32 9.5 40 2.2 2.4 0.95 0.95 1.0 1.4 2.0 1.0 2.6	1.72 2.0 2.5 4.7 5.4 6.0 9.5 11 14 17.5 100-150 150-1000	1.0 0 2 2 7 1 4.6 6.2 29.5 4.6 Negligible

Note:

- I. Motor was covered with screen and newfilter was installed.
- 2. Equivalent input is voltage required at receiver antenna terminal to give same output as obtained with noise probe.
- 3. Measurements were made with standard noise probe and the following receivers.

  DZ-2 100Kc-200Kc, 500Kc-1500Kc BC-639 100Mc-156Mc
  BC-348 200Kc-500Kc, 1.5Mc-18Mc ...N/..PR-4 156Mc-1000Mc.

T.BLE 2

#### R.DL.TED NOISE - BLOWER MOTOR HD-6

Freq.	Equivalent	Input		Equivalent	Input V
Mc.	Before Correction	"Iter Correction	Freq.	Correction	After Correction
0.104 0.119 0.144 0.172 0.200 0.300 0.400 0.500 0.582 0.692 0.791 0.840 1.2	47 36 48 18 over 100 over 50 over 100 over 65 5.6 6.2 20 9.0 5.9	5.4 6.0 4.6 4.3 16 9.5 12 4.8 0.5 0.6 1.6 0.9	1.72 2.0 2.5 3.0 3.5 4.7 5.4 7.6 9.5 12.5 15 17.5 100-156 156-1000	6.0 over 400 over 100 6.0 6.0 8.5 5.4 9.0 3.3 4.2 1.2 1.4 Negligible	0 0.1 0.5 0.8 0.3 2.8 1.0 1.0 1.0 0.5 0.5 Negligible

Note: l. Equivalent input is voltage required at receiver unterna terminal to give some output as obtained with noise probe.

2. Measurements were made with standard noise probe and the following receivers; Dz-2 100Kc-200Kc, 500Kc-1500Kd, BC-639 100kc-156Mc Bc-348 200kc-500Kc, 1.5Mc-18Mc an/aPR-4 156Mc-1000Mc.

TABLE 3

#### RADI.TED NOISE - BLOWER MOTOR HD-7

( 1 Å I 4 1 I I I	Louivalent	Input uV		Equivalent	Input $\mu^{tr}$
Freq.	Before Correction	fter Correction	Froq.	Before Correction	orrection
0.104 0.119 0.114 0.172 0.200 0.300 0.400 0.500 0.582 0.692 0.791 0.840 1.2 1.47 1.72 2.0	1.7 2.2 1.8 2.1 20 13 46 24 2.7 2.8 5.1 5.7 2.4 26 1.5	4.2 6.0 3.9 3.7 16 .9.5 12 0.5 0.6 0.6 1.4 0.9 0.1	2.5 3.0 3.5 4.1 4.7 5.4 7.6 9.5 12.5 17.5 100-156 156-1000	12.5 8 7 over 160 17 5.4 5.5 4.7 0 0 Negligible	0.5 0.9 0.3 0.8 0.7 0.5 0.5 0 0 Negligible

- Note: 1. Equivalent input is voltage required at receiver antenna terminal to give some output as obtained with noise probe.
  - 2. Measurements were made with standard noise probe and the following receivers: DZ-2 100Kc-200Kc, 500Kc-1500Kc BC639 100Mc-156Mc BC-348 200Kc-500Kc, 1.5Mc-18Mc.N/APR-4 156Mc-100CMc.

#### RADIATED NOISE - MODUL.TOR UNIT

Table 4

	Equivalent	Input #V	Freq.	Equivalent Input 4V			
Freq.	Rear of Modulator	Modulator Cover Ring	hic.	Rear of Modulator	Modulator		
0.104 0.119 0.144 0.172 0.200 0.300 0.400 0.500 0.582 0.692 0.791 0.840 1.2	200 190 122 72 33 18 42 21 12 13 46 24	100 125 70 40 32 16 40 20 10 13 16 12	1.72 2.0 2.5 3.0 3.0 3.5 5.4 7.6 9.5 12.5 15	17 6.2 5.0 6.5 7.0 5.7 13 3.7 2.0 1.9 5.3 2.2 Negligible	6.0 5.1 4.0 5.6 5.6 5.3 10 4.5 2.6 2.1 5.3 2.2		

#### Note:

- 1. These measurements were made after remedial steps had been taken. Before correction receivers were saturated from 100kc to 18kc.
- 2. Equivalent input is voltage required at receiver antenna terminal to give some output as obtained with noise probe.
- Measurements were made with standard noise probe and the following receivers: DZ-2 100kc-200kc, 500kc-1500kc BC-639 100Mc-156Mc BC348 200Kc-500Kc, 1.5Mc-18Mc AN/APR-4 156Mc-1000Mc.

T.BLE 5

#### LINE CONDUCTED NOISE - D C LINE TO GROUND

Freq.	Noise #V.	Freq.	Noise
0.20 0.24 0.28 0.32 0.55 0.75 1.05 1.30 1.55	60 50 35 250 200 30 10 7 8 12	2.4 3.1 3.4 3.6 5.0 6.0 8.0 8.5 9.0 10 16	9 12 150 100 45 40 90 9 150 50

#### Note:

- 1. These measurements were made after remedial steps had been taken. No readings are available for the D-C conducted noise before correction since efforts to reduce radiated noise undoubtedly affected the conducted noise.
- 2. Measurements were made with Ferris Model 32-B Noise Meter.

TABLE 6

LINE CONDUCTED NOISE - A-C LINES TO CROUND

	Noise in		μV			Noise		in	μV
Freq.	ØA Before	Afte	r Corre	ction	Freq.	DA Before	124	ter Corr	ection
in ilc.	Correction	ØA	ØВ	øç		Correction	ØA	ØB	Ø
0.20	100,000+	75	75	60	3.9	100	1	1	0
0.24	100,000+	150	65	50	5.5	50	2	2	1
0.28	100,000+	75	50	35	8.0	200	2	7	3
0.32	100,000+	50	40	20	8.5	200	11	6	ó
0.35	30,000	30	25	20	10	50	1	1	2
0.55	2,000	70	70	75	12	220	2	1	4
0.75	1,000	35	30	15	16	20	9	5	2
1.05	1,000	10	10	30	19	10	C	Ó	0
1.30	1,100	: 3	11	10		1	1		
1.55	1,500	1	2	5		i	1		
1.8	15C	8	10	8		i	1 3		
2.4	400	7	11	7			8		
3.1	300	. 5	10	7		1	1		


Notes: 1. Conducted noise on phases B and C before correction was comparable to that of phase A.

- The correction used was the filter shown in Plate 1 and Table 7.
- Measurements were made with a Ferris model 32-B Noise Meter.

TABLE 7

# COIL DATA MODULATOR FILTER

Coil	Wire	s	pindle	Total Turns	Spacing	Layers	
À	#15 enamol	3/4"	Bakelite	19	Single	One	
В	#15 enamel	3/4"	Bakelite	32	Single	One	
С	#15 ename1	1 1/8"	Bakelite	18	Double	One	
D	#15 cnamel	3/4"	Bakelite	27	Single	One	
E	#23 enamel	3/4"	Iron	70	Single	One	
F	#23 enamel	1 1/3"	Bakelite	40	Double	One	
G	#15 enamel	3/4"	Iron	105	Single	Three	

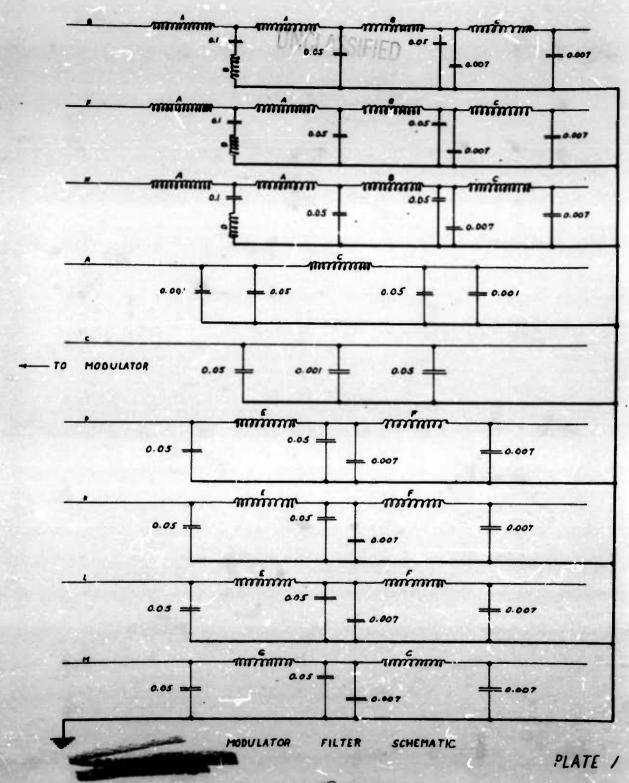

#### DISTRIBUTION LIST

BuShips (938) (15) copies BuAer. (6) copies ORI,(1) copy NAS, Patuxent (1) copy USNEL, Point Loma (1) copy Sec. Airc. & Elect. Com. (1) OP-413-B2 (5) copies

UNCLASSIFIED